

クランプ固定方法

Desk

S=3mm Allen key

S=3mm

M4x30 (x4) Screws

12X5.8X16 (x4)

180° swivel

ケーブル収納

Insert cable

一ムが抜けないように

薄い天板の場合

Measure the thickness of the table

\$ 15-60 mm

Desk Clamp Installation

天板

Arm Installation

Desk

Max:85mm (Max:3.4")

Loosen clamp screw until enough space is left for the edge of the desk.

ームをクランプ軸に差込み

Tighten clamp using clamp screw until mount is securely fastened to desk.

六角ネジで回転を調整
Install the arm to the base and fasten the screw in the back.

Monitor Installation

3 For Flat Screen Monitors

**A Max12 (x4)
Screws

A Parameter A Max12 (x4)
Screws

**A Max12 (x4)
Screws

A Max12 (x4)
**Screws*

A Max12 (x4)
**A Max12 (x4)
**Screws*


A Max12 (x4)
**A Max12 (x4)
**Screws*

A Max12 (x4)
**A Max

Flat Screen Monitors installation: Install 4 screws through faceplate to

monitor via mounting holes.

For Curved Monitors




差込み

ネジ止め

Insert the monitor along with the VESA plate to the arm and lock it.

背面凹み型モニターの場合

スペンサーをご使用下さい

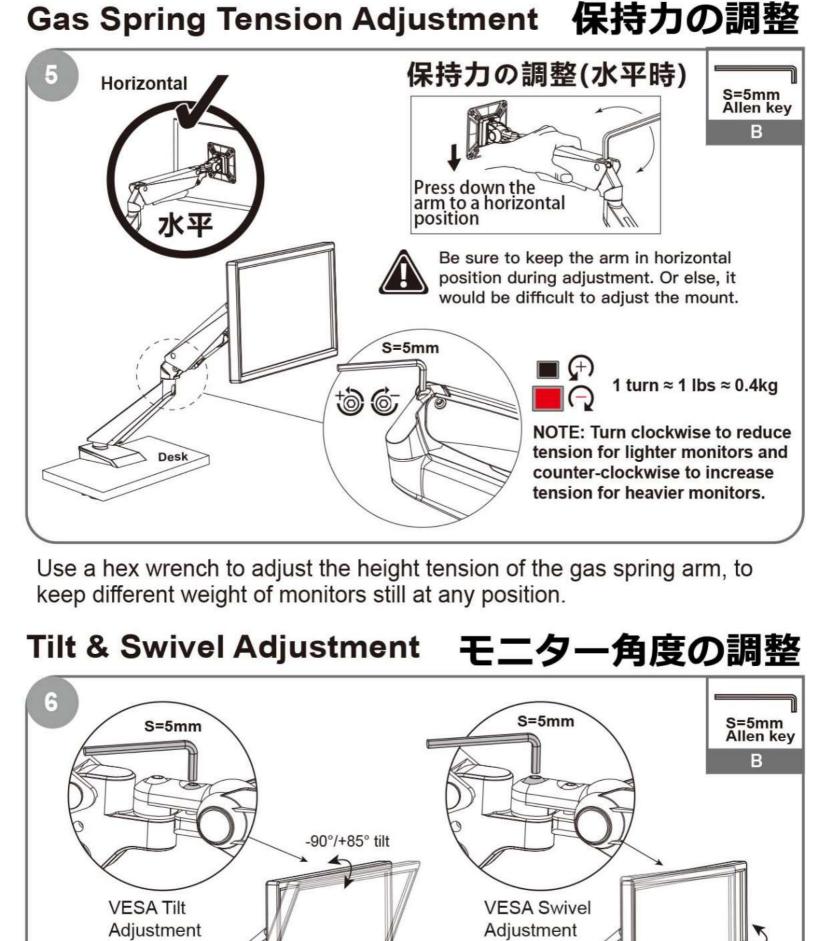


ネジ止め

Turn counter-clockwise to reduce damping and clockwise to increase damping.

Use a hex wrench to adjust the damp for swiveling and tilt.

Cable Management Installation

Loosen

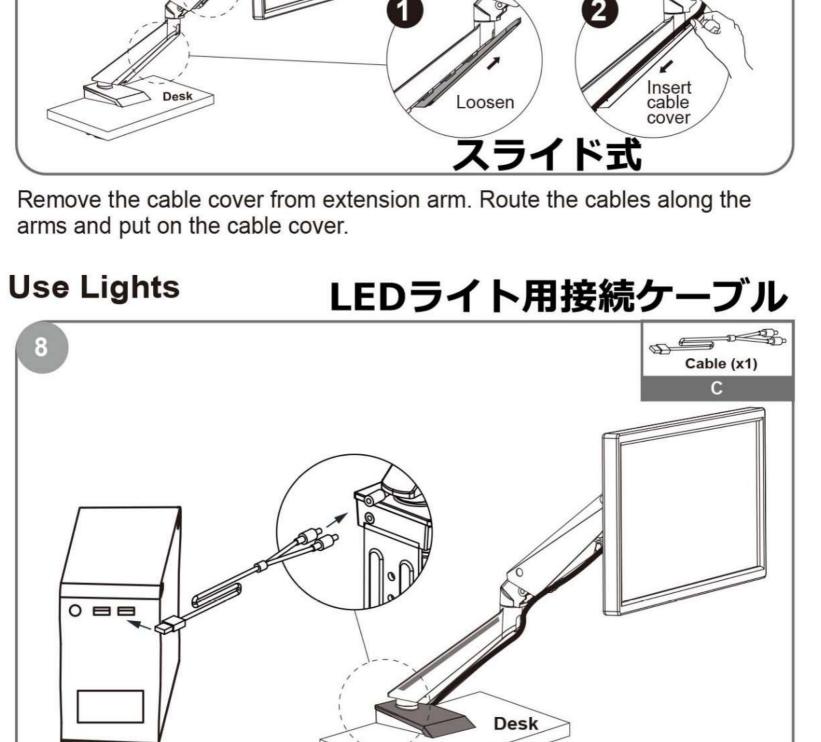

Des

Use USB cable for LED backlight embellishment.